
OPERATION MANUAL



Serial Number



EK1550FLT and EK1550FLX GATOR[®] Battery-powered, 15-ton Crimping Tools

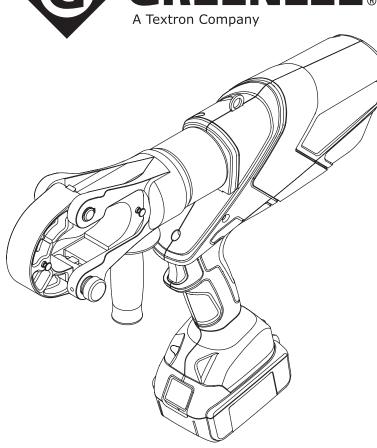

Read and **understand** all of the instructions and safety information in this manual before operating or servicing this tool.

Register this product at www.greenlee.com © 2016 Greenlee Textron Inc.

10/16



Table of Contents

Description	2
Safety	2
Purpose of this Manual	2
Important Safety Information	3–4
Identification	5
Specifications	5
Adapter Kits	6
Setup	7
Operation	
Die Selection	9
Connector Selection	9
LCD Screen	10
Maintenance	11
Troubleshooting	12

Description

The EK1550FLT and EK1550FLX Battery-powered, 15-ton, High-speed Crimping Tools are hand-held, selfcontained crimping tools intended to crimp aluminum and copper connectors onto electrical cable.

These tools have a retraction stop feature which allows the operator to stop the retraction motion of the ram to shorten cycle time.

Both the T and X versions of this tool have Bluetooth[®] connectivity and an LCD screen. Only the T version has GPS tracking.

These tools are protected by U.S. Patent No. 6.206.663. 6,276,186, 6,401,515, and 6,718,870.

EK1550FLT-FCC ID: 2AGL2COM; IC ID: 20646COM EK1550FLX-FCC ID: 2AGL2CFM; IC ID: 20646CFM

This device complies with Part 15 of the FCC Rules. Operation is subject to the following two conditions: (1) this device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.

Safety

Safety is essential in the use and maintenance of Greenlee tools and equipment. This manual and any markings on the tool provide information for avoiding hazards and unsafe practices related to the use of this tool. Observe all of the safety information provided.

Purpose of this Manual

This manual is intended to familiarize all personnel with the safe operation and maintenance procedures for the following Greenlee tools:

- EK1550FLT Battery-powered Crimping Tool
- EK1550FLX Battery-powered Crimping Tool

Keep this manual available to all personnel.

Replacement manuals are available upon request at no charge at www.greenlee.com.

Do not discard this product or throw away! For recycling information, go to www.greenlee.com.

All specifications are nominal and may change as design improvements occur. Greenlee Textron Inc. shall not be liable for damages resulting from misapplication or misuse of its products. GATOR is a registered trademark of Textron Innovations Inc. Bluetooth is a registered trademark of Bluetooth SIG. Inc. Blackburn is a registered trademark of Thomas & Betts.

KEEP THIS MANUAL

IMPORTANT SAFETY INFORMATION





This symbol is used to call your attention to hazards or unsafe practices which could result in an injury or property damage. The signal word, defined below, indicates the severity of the hazard. The message after the signal word provides information for preventing or avoiding the hazard.

Immediate hazards which, if not avoided, WILL result in severe injury or death.

Hazards which, if not avoided, COULD result in severe injury or death.

Hazards or unsafe practices which, if not avoided, MAY result in injury or property damage.

AWARNING

Read and understand all of the instructions and safety information in this manual before operating or servicing this tool.

Failure to observe this warning could result in severe injury or death.

AWARNING



Electric shock hazard:

This tool is not insulated. When using this unit on or near energized electrical lines, use proper personal protective equipment.

Failure to observe this warning could result in severe injury or death.



AWARNING

Wear eye protection when operating or servicing this tool.

Failure to wear eye protection could result in serious eye injury from flying debris or hydraulic oil.

AWARNING



Skin injection hazard:

Do not use hands to check for oil leaks. Oil under pressure easily punctures skin. If injured, seek medical attention immediately to remove oil.

Failure to observe this warning could result in serious injury, gangrene, or death.



AWARNING

Do not use solvents or flammable liquids to clean the tool body. Solvents or flammable liquids could ignite and cause serious injury or property damage.

An incomplete crimp can cause a fire.

- Use proper die, connector, and cable combinations. Improper combinations can result in an incomplete crimp.
- The relief valve sounds and the ram automatically retracts to indicate a completed crimp. If you do not hear the sound of the relieve valve or the ram does not automatically retract, the crimp is not complete.

Failure to observe these warnings could result in severe injury or death.

AWARNING

Pinch points:

- Remove battery before changing dies, adapters, or jaws.
- Keep hands away from the crimping tool head when crimping.

Failure to observe these warnings could result in severe injury or death.

IMPORTANT SAFETY INFORMATION

AWARNING

Do not dispose of batteries in a fire. They will vent fumes and may explode.

REENLEE

Failure to observe this warning could result in severe injury from harmful fumes or burns from flying debris.

Remove the battery before transporting the T version of this tool by air.

Failure to observe this warning could result in severe injury or death.

- Inspect tool and dies before use. Replace any worn or damaged parts. A damaged or improperly assembled tool can break and strike nearby personnel.
- Carrying strap is for carrying only, not to be used to hang or suspend tool.

Failure to observe these warnings could result in severe injury or death.

ACAUTION

- Do not use this tool for continuous use. After 30 to 40 cycles, allow the tool to cool for 15 minutes.
- Do not secure this tool in a vise. This tool is designed for hand-held operation.
- This tool may be used in damp or wet environments; however, air-drying is recommended before use if the tool becomes soaked. Damage may result when the tool is operated prior to thorough drying when electrical components are soaked.
- Use this tool for the manufacturer's intended purpose only.

Failure to observe these precautions may result in injury or property damage.

Do not allow anything to contact the battery terminals.

- Do not immerse the batteries in liquid. Liquid may create a short circuit and damage the battery. If batteries are immersed, contact your service center for proper handling.
- Do not place the battery into a pocket, tool pouch, or tool box with conductive objects. Conductive objects may create a short circuit and damage the battery.
- Do not place a battery on moist ground or grass. Moisture may create a short circuit and damage the battery.

Failure to observe these precautions may result in injury or property damage.

- Do not store the battery at more than 122 °F (50 °C) or less than –4 °F (–20 °C). Damage to the battery can result.
- Do not use another manufacturer's charger. Other manufacturers' chargers may overcharge and damage the battery.
- Do not attempt to open the battery. It contains no user-serviceable parts.

Failure to observe these precautions may result in injury or property damage.

Do not perform any service or maintenance other than as described in this manual. Injury or damage to the tool may result.


Failure to observe this precaution may result in injury and property damage.

Note: Keep all decals clean and legible, and replace when necessary.



Identification

- 1. Die Release Buttons
- 2. Lanyard Ring
- 3. Housing
- 4. Retract Button
- 5. LED Indicator (red)
- 6. LCD Screen
- 7. Battery
- 8. Trigger
- 9. LED Work Light (white)
- 10. Pull Pin
- 11. Ram
- 12. Flip-top Head
- 13. Handle

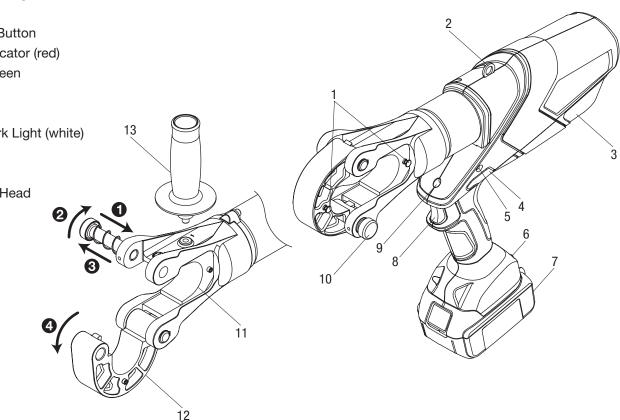

Specifications

Crimping Tool

Length	19.00" (483 mm)
Width	3.00" (76 mm)
Height (with battery)	13.5" (342 mm)
Mass/Weight (with battery)	18.2 lb (8.25 kg)
Crimping Force	15 tons (135 kN)
Hydraulic Oil 52057878 biodegra	dable hydraulic fluid
Recommended Operating Temperature Range5 °F to 122	°F (–15 °C to 50 °C)

Battery Charger

Read the instructions supplied with the battery charger

Crimping Capacities

Chimping Capacities	
Maximum Crimping Capacity Aluminum	
Copper	1500 kcmil
With "P" Style Dies (no adapter kit needed): 1250 kcmil aluminum and 1500 kcmil copper fittings	
With 52060610 Die Adapter Set for 12-ton "U" Style Dies: 500 kcmil copper splices, 750 kcmil copper terminals, 350 kcmil aluminum splices, 750 kcmil aluminum terminals	
Note: Do not use non-butting dies (crimps co	ontrolled

by tonnage) in this tool, as damage could occur to connectors and/or conductors.

5

Adapter Kits


Procedure for Using Burndy Y46 Dies and "P" Style Dies

GREENLEE

- 1. No die holder assemblies are needed. Dies fit directly into tool.
- 2. Select proper die set for fitting to be crimped.


Note: Do not use non-butting dies (crimps controlled by tonnage) in this tool, as damage could occur to connectors and/or conductors.

 Slide top die into place in die holder while simultaneously squeezing retainer button. Release button and allow die to snap into place. Repeat operation for other die entry.

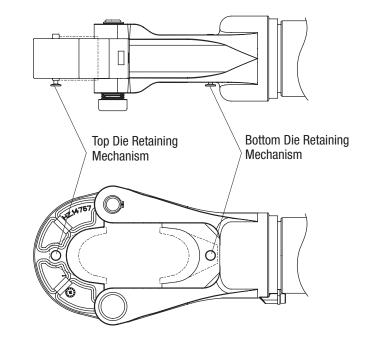

Procedure for Using 12-ton "U" Style Dies with 52060610 Die Adapter Set

- Slide a die adapter assembly into the flip-top head while depressing the die retainer button. Release the retainer button while the adapter snaps into place. The die adapter should be locked in position.
- 2. Repeat Step 1 to install the other die adapter into the ram end.
- 3. Select the proper "U" die set for the connector to be crimped.
- 4. Slide the "U" die into the die adapter while depressing the die retainer button. Release the die button while it snaps into place, locking the die into position.
- 5. Repeat Step 4 with other "U" die.

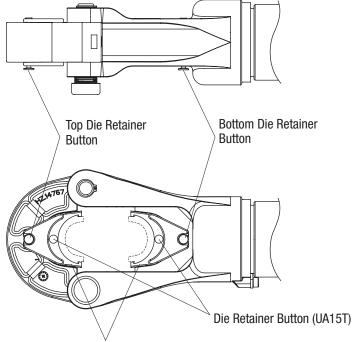

12-ton "U" Die Adapter Set UA15T (52060610) (contains two die adapters)



Setup

- 1. Select the die set that corresponds to the size, type, and manufacturer of connector to be crimped.
- 2. Determine if the die adapter set is required:
 - "P" style dies-no die adapters required
 - 12-ton "U" style dies-52060610 die adapter set
- 3. Install proper size crimping dies in crimping head. Be sure die seat area is clear of debris.

Operation

AWARNING

- Inspect tool and dies before use. Replace any worn or damaged parts. A damaged or improperly assembled tool can break and strike nearby personnel.
- Carrying strap is for carrying only, not to be used to hang or suspend tool.

Failure to observe these warnings could result in severe injury or death.



AWARNING

Electric shock hazard:

This tool is not insulated. When using this unit on or near energized electrical lines, use proper personal protective equipment.

Failure to observe this warning could result in severe injury or death.

AWARNING

Wear eye protection when operating or servicing this tool.

Failure to wear eye protection could result in serious eye injury from flying debris or hydraulic oil.

AWARNING

Pinch points:

- Remove battery before changing dies, adapters, or jaws.
- Keep hands away from the crimping tool head when crimping.

Failure to observe these warnings could result in severe injury or death.

ACAUTION

- Do not use this tool for continuous use. After 30 to 40 cycles, allow the tool to cool for 15 minutes.
- Do not secure this tool in a vise. This tool is designed for hand-held operation.
- This tool may be used in damp or wet environments; however, air-drying is recommended before use if the tool becomes soaked. Damage may result when the tool is operated prior to thorough drying when electrical components are soaked.
- Use this tool for the manufacturer's intended purpose only.

Failure to observe these precautions may result in injury or property damage.

Charging the Battery

Read the instructions supplied with the battery charger.

LED Work Light (white)

This LED automatically turns on when the trigger is pulled. It remains on for 10 seconds after the trigger is released.

LED Indicator (red)

This tool is equipped with a special circuit board incorporating several important features to inform the user about the current status of the unit. The LED signals in the following cases:

What happens	Signal	What it means
Constant light for 20 seconds at end of cycle		Battery charge is below 17 V at beginning of cycle*
Tool will not start, and constant light for 20 seconds when trigger is released		Battery charge is below 16 V at beginning of cycle*
Tool will stop, and constant light for 20 seconds after trigger is released		Battery voltage drops below 13 V during cycle*
Tool will stop, and flashing light for 20 seconds when	••••	Motor current exceeds 20 A during cycle
trigger is released		Circuit has become too hot
Flashing light for 20 seconds at end of cycle	••••	Send tool in for service

* Running the battery below 16 V can damage the battery.

Operation (cont'd)

GREENLEE

Pressure Sensor

This tool is equipped with a pressure sensor that alerts the user of an incomplete crimp.

- If the tool is manually retracted before completion of a crimp, the red LED and an audible beep will be active for 2 seconds.
- If the tool is unable to reach the required crimp force, the red LED, work light, and an audible beep will pulse until after the trigger is released.

IMPORTANT

For a cUL or UL classified crimp, see the connector table in this instruction manual.

Preparation

Note: When using KC12-type dies, complete the number of crimps listed on the "Connector Selection" chart in this manual. For other dies, complete the number of crimps specified by the manufacturer.


- 1. Select a proper size and type of connector to correspond with the wire or cable.
- 2. Strip the cable to an appropriate length. Follow the connector manufacturer's instructions.

Note: Apply an oxide inhibitor, if required. See the connector manufacturer's instructions.

3. Clean the die seat area.


Crimping

- 1. Insert the cable fully into the connector.
- 2. If open, close the flip-top head and engage the pull pin. Make sure the pull pin is fully engaged.
- 3. Align the connector between the crimping dies as shown below.

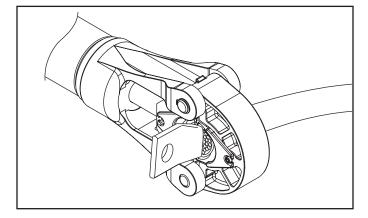

4. For a UL or cUL classified crimp, complete the number of crimps specified under "Connector Selection".

5. For a single crimp, position the connector so the crimp will be located at the center of the barrel.

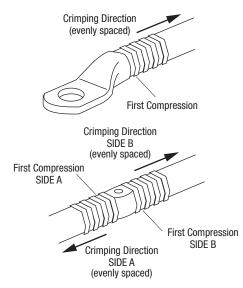

6. Depress the trigger to advance the ram. Hold the trigger down until the ram automatically begins to retract.

Notes: If the crimping tool does not automatically retract, the crimp is incomplete.

It is normal for the battery load display to light at both the beginning and near the end of the crimping cycle.

- 7. Release the trigger until the ram retracts completely.
- 8. To stop the ram from returning fully, activate the trigger for a brief moment. This activation will close the retraction valve and stop the retraction motion.

Note: if it is necessary to retract the ram before a crimp cycle is complete, push the retract button. Pushing the retract button will result in complete retraction of the ram.

After completing the last crimp on an aluminum connector, wipe off the excess oxide inhibitor.

An incomplete crimp can cause a fire.

- Use proper die, connector, and cable combinations. Improper combinations can result in an incomplete crimp.
- The relief valve sounds and the ram automatically retracts to indicate a completed crimp. If you do not hear the sound of the relieve valve or the ram does not automatically retract, the crimp is not complete.

Failure to observe these warnings could result in severe injury or death.

EK1550FLT and EK1550FLX Battery-powered Crimping Tools

Dies for Aluminum Connectors

Die Selection

Refer to "Connector Selection" for brand names and model numbers of appropriate lugs as well as crimping instructions.

Crimps made with this tool and KC12-type or KA12-type dies are cUL and UL classified when used with the appropriate conductor and connectors listed below.

Dies for Copper Connectors

GREENLEE®

Catalog No.	UPC No.	Cable Size	Color Code	No. of Crimps
KC12-8	10996	8 AWG	Red	1
KC12-6	10997	6 AWG	Blue	1
KC12-4	10998	4 AWG	Gray	1
KC12-2	10999	2 AWG	Brown	1
KC12-1	11003	1 AWG	Green	1
KC12-1/0	11004	1/0 AWG	Pink	1
KC12-2/0	11007	2/0 AWG	Black	1
KC12-3/0	11010	3/0 AWG	Orange	1
KC12-4/0	11011	4/0 AWG	Purple	1
KC12-250	11012	250 kcmil	Yellow	1
KC12-300	11013	300 kcmil	White	2
KC12-350	11014	350 kcmil	Red	2
KC12-400	11015	400 kcmil	Blue	2
KC12-500	11016	500 kcmil	Brown	2
KC12-600	11018	600 kcmil	Green	2
KC12-750	11020	750 kcmil	Black	2

Catalog No.	UPC No.	Cable Size	Color Code	No. of Crimps
KA12-8	22084	8 AWG	Blue	1
KA12-6	22085	6 AWG	Gray	1
KA12-4	22086	4 AWG	Green	1
KA12-2	22087	2 AWG	Pink	1
KA12-1	22088	1 AWG	Gold	1
KA12-1/0	22089	1/0 AWG	Tan	1
KA12-2/0	22090	2/0 AWG	Olive	2
KA12-3/0	22121	3/0 AWG	Ruby	2
KA12-4/0	22122	4/0 AWG	White	2
KA12-250	22123	250 kcmil	Red	2
KA12-300	22124	300 kcmil	Blue	2
KA12-350	22125	350 kcmil	Brown	2
KA12-400	22126	400 kcmil	Green	3
KA12-500	22127	500 kcmil	Pink	3
KA12-600	22128	600 kcmil	Black	3
KA12-750	22129	750 kcmil	Yellow	3

Connector Selection

Tool Range: 8 AWG to 750 kcmil

When used with KC12-type dies, this tool is cUL and UL classified for use with the following connector brands:

Connector Type	Barrel Type	Anderson	Blackburn®	Burndy	ILSCO	Panduit	T&B	Penn- Union	Number of Crimps*
Copper	Short	VHSS	CSP	YS-L	СТ	SCSS SCS	54504 to 54523-TB	BCU	
Splice	Long	VHS	CU	YS	CTL	SCL SCH	54804 to 54823	BBCU	8 AWG to 250 kcmil:
Copper	Short	VHCS	CTL-2/CTL	YA-2LN/ YA-L/YA-2L; YA/YA-L-TC/ YA-L-2TC	CSW CRA/CRB CRC	LCAS LCA LCD LCAN	54104 to 54123-TB; 54204 to 54223	BLU	1 crimp 300 to 750 kcmil: 2 crimps
Lugs	Long	VHCL	CTL-L/LCN	YA/YAZ YA-2N/YA-2TC YAZ-2N/YAZ-2TC	CLN, CLW CRA-L/CRB-L CRA-2/CRB-2L CRC-2L	LCB LCC	54930BE to 54923BE; 54850BE to 54880BE	BBLU	

When used with KA12-type dies, this tool is cUL and UL classified for use with the following connector brands:

Connector Type	Anderson	Blackburn®	Burndy	ILSC0	Panduit	T&B	Penn- Union	Number of Crimps*
Dual-Rated Aluminum Splice	VACS	ASP	YS-A	AS ASN	SA	60501 to 60578	PIK	8 to 1/0 AWG: 1 crimp 2/0 AWG to
Dual-Rated Aluminum Lugs	VACL	ATL	ya-a ya-atn	ACL/ACN 2ACL/2ACN ALNS/ALNN/ALND	LAA LAB	60101 to 60176; 60230 to 60278	BLUA	350 kcmil: 2 crimps 400 to 750 kcmil: 3 crimps



* Use the number of crimps listed in this column instead of the number provided with the connector.

LCD Screen

This tool has an LCD screen, which displays information about the tool. Turn on the screen by inserting the battery and jogging the tool. If there are any problems with the tool, an error code appears.

REENLEE

Error Code	Meaning	
1	Overcurrent fuse	
2	Overcurrent comparator	
3	Overheated circuit board	
4	Overheated battery	
5	Battery empty; operation stops	
6	Faulty crimp; complete cycle	
7	Faulty crimp; incomplete cycle	
8	Low battery	
9	Battery empty; tool won't run	
10	Real-time clock battery low	
11	Tool deactivated	
12	Service necessary	
13	Real-time clock not found	
14	Bluetooth [®] unit not found	
15	Mobile unit not found	
16	Pressure sensor not found	
17	Burst pressure exceeded	
18	Battery temperature too low	

If there is no error code, cycle through the various displays using the left and right buttons on either side of the screen. There are seven displays in total.

Display	Information Shown
1	Bluetooth [®] status, battery charge, current pressure, max. pressure
2	Firmware, available firmware update, serial number
3	Current user. Press and hold both buttons to change user, select with right button, and confirm by jogging the tool.
4	GSM/CDMA signal strength
5	GPS signal status
6	Cycles until next service
7	Since manufacturing: operating hours, capacity, number of cycles

Note: Tool data transmission starts with production of the tool, independent of registration on i-connect, but only for the T version of this tool.

10



Maintenance

AWARNING

Wear eye protection when operating or servicing this tool.

Failure to wear eye protection could result in serious eye injury from flying debris or hydraulic oil.

AWARNING

Skin injection hazard:

Do not use hands to check for oil leaks. Oil under pressure easily punctures skin. If injured, seek medical attention immediately to remove oil.

Failure to observe this warning could result in serious injury, gangrene, or death.



AWARNING

Do not use solvents or flammable liquids to clean the tool body. Solvents or flammable liquids could ignite and cause serious injury or property damage.

AWARNING

Pinch points:

- Remove battery before changing dies, adapters, or jaws.
- Keep hands away from the crimping tool head when crimping.

Failure to observe these warnings could result in severe injury or death.

IMPORTANT

Relief valve adjustments must be done by an authorized service center.

Daily

Before use:

- 1. Inspect the tool for wear or damage, such as cracks, gouges, or chips.
- 2. Inspect the tool for damage or leaks.
- 3. Inspect the rotation of the head assembly. Fully retract the ram. The head should rotate no more than 360°. If damage is detected, contact Greenlee customer service at 800-435-0786 for warranty service or repair.

After use:

- 1. Use a damp cloth and mild detergent to clean the housing. Allow the housing to dry.
- 2. Fully retract the ram. Place the tool in the carrying case and store in a cool, dry place.
- 3. If necessary, recharge the batteries. Refer to the instructions supplied with the battery charger.

Monthly

Thoroughly clean all surfaces.

Annually or After 10,000 Crimps

Contact Greenlee customer service at 800-435-0786 for warranty service or repair, and hydraulic oil replacement.

Troubleshooting

GREENLEE

Before You Begin

- 1. Make sure that the battery is charged. Recheck the battery after several minutes to make sure the battery is holding its charge.
- 2. Use a nonflammable contact cleaner or pencil eraser to clean the electrical contacts on the battery and tool.
- 3. Reinstall the battery and check the tool again.

Problem	Possible Cause	Probable Remedy
Tool is inoperative.	Battery charge low.	Charge or replace battery.
	Dirt, contaminants, etc., in ram area of tool.	Clean tool.
	Tool components worn or damaged.	Contact Greenlee customer service at 800-435-0786 for warranty service or repair.
Motor is inoperative.	Low or uncharged battery.	Try known charged battery. Inoperative battery may be discharged or may have reached life expectancy.
	Broken switch components.	Contact Greenlee customer service at 800-435-0786 for warranty service or repair.
Motor runs but tool will not complete a cycle.	Oil level low.	Contact Greenlee customer service at 800-435-0786 for warranty service or repair.
	Air in hydraulic system.	Pull trigger and hold retract button simultane- ously. Run for approximately 10 seconds, and then attempt to crimp. If unsuccessful, contact Greenlee customer service at 800-435-0786 for warranty service or repair.
	Cold oil.	Pull trigger and hold retract button simultaneously to warm oil. Store tool in warm area.
Tool loses oil.	Damaged seal.	Contact Greenlee customer service at 800-435-0786 for warranty service or repair.



4455 Boeing Drive • Rockford, IL 61109-2988 • USA • 815-397-7070 An ISO 9001 Company • Greenlee Textron Inc. is a subsidiary of Textron Inc.

www.greenlee.com

Fax: 800-451-2632

Fax: 800-524-2853

USA Tel: 800-435-0786 Canada Tel: 800-435-0786 International Tel: +1-815-397-7070 Fax: +1-815-397-9247